


## Ezy-Push® CP-BS Lead Safe™ Timeflow Push Button Deluxe Bib Tap

**PRODUCT CODES:**


- 173.46.21.00 – 6 Sec.
- 173.46.41.00 – 15 Sec.

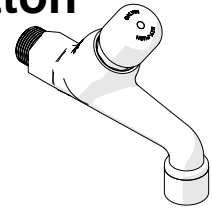

## Ezy-Lever® Lead Safe™ Timeflow Lever Action Vandal Resistent Deluxe Bib Tap

**PRODUCT CODES:**

- 173.46.23.00 – 6 Sec.

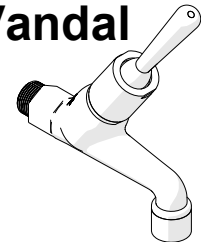

### SPECIFICATIONS

- Time flow taps are designed to operate at full mains pressure.
- The valve has a unique self-closing operation.
- The taps are made of chrome plated Lead Safe\* DR Brass.
- Clean hygienic design.
- Water saving and vandal resistant.
- Low maintenance and easy to operate.
- Smooth round designs to facilitate easy clean and help reduce dirt and bacteria growth.

*Note: Time is based on 500kPa, @ 22 degrees Celsius. Time will vary plus or minus 30% based on water temperatures, pressures, flow rates and water quality.*

*\* As 'lead free' is not currently defined by law in Australia and New Zealand, we have based our definition of Lead Safe™ on the requirements of s1417 of the USA's Safe Drinking Water Act (SDWA) and the relevant US standards NSF61 / NSF372. The SDWA defines 'lead free' as "not more than a weighted average of 0.25% lead when used with respect to the wetted surface of pipes, pipe fittings, plumbing fittings and fixtures".*

**IMPORTANT:** All Ezy-Push® Time Flow Deluxe Bib taps are tested in accordance with AS/NZS 3718 and leave our premises in good working order. Time may vary due to changes in temperature, pressure, flow rate and water quantity.

### TECHNICAL DATA

Inlet	½" BSP - Male	
Outlet	Aerator	
Headwork	Time Flow Cartridge	
Working Pressure Range (kPa)	Min	100
	Max	500
Working Temperature Range (°C)	Min	5
	Max	65
Nominal Flow Rate (LPM)	4.8	
Construction	Brass	
Finish	Chrome	


**NOTE:** Galvin Engineering continually strive to improve their products. Specifications may change without notice.

**TOOLS REQUIRED**


- Spanner or adjustable crescent
- Thread tap or sealant

**PRE-INSTALLATION**

- Before installation, all lines must be flushed. We recommend that a line strainer be installed prior to Time Flow Deluxe Bib taps to eliminate any foreign material.

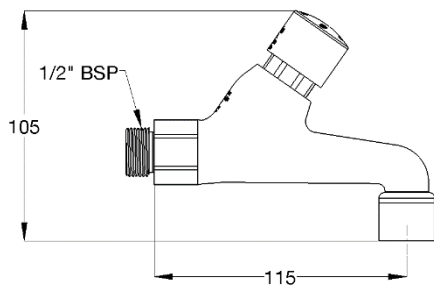


Item codes: 173.46.21.00 & 173.46.41.00

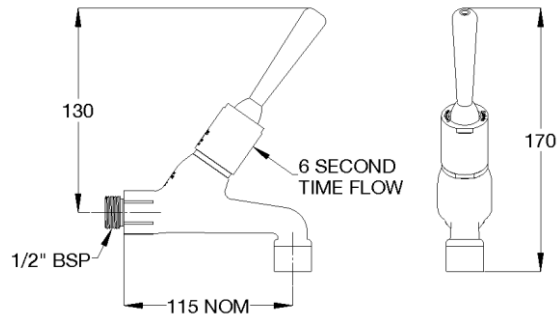


Item code: 173.46.23.00

**INSTALLATION**


**IMPORTANT:** Galvin Engineering products must be installed in accordance with these installation instructions and in accordance with AS/NZS 3500, the PCA and your local regulatory requirements. Water and/or electrical supply conditions must also comply to the applicable national and/or state standards. Failing to comply with these provisions shall void the product warranty and may affect the performance of the product.

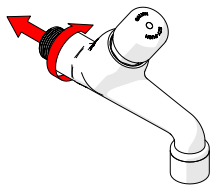


Item codes 173.46.21.00 and 173.46.41.00

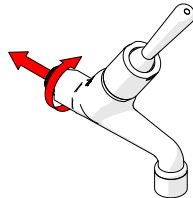

Item code 173.46.23.00

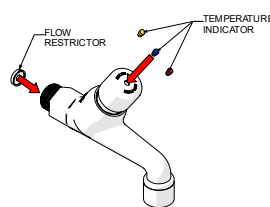

Item code 173.46.21.00 and 173.46.41.00

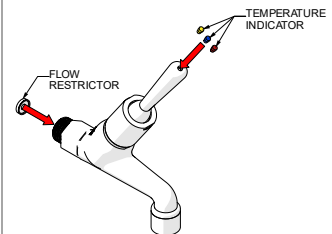


Item code 173.46.23.00

**1. Fit tap assembly**

- Time flow taps are fitted with flow restrictors.
- When applying thread tape or sealant to the inlet, ensure the opening is not obscured. Failure to do so may restrict or block the flow restrictor, affecting the flow of water.

**2. Replacing flow restrictor if required**

- Major restrictions to the supply pressure (e.g. refrigeration units) may effect the water stream and the flow restrictor may need replacing with a flow restrictor of greater capacity to increase the flow. However, using a different flow restrictor will void the 6 star rating.
- Never operate without a flow restrictor, as Time Flow Deluxe Bib taps will deliver full mains pressure with unrestricted flow.
- Fit the appropriate water temperature indicator (Cold, Hot or Warm).

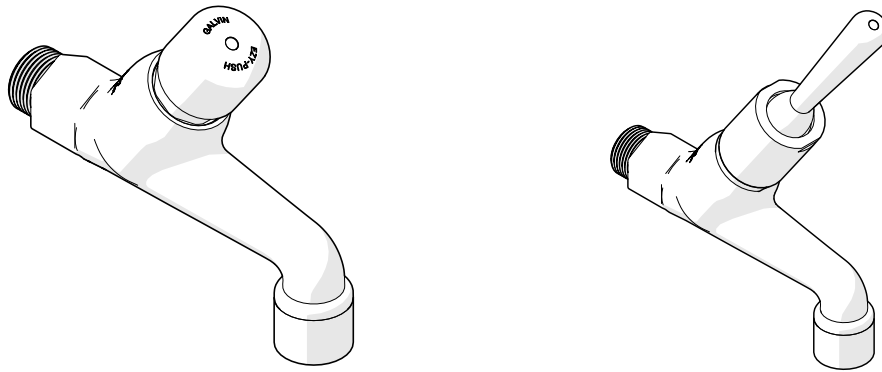

**3. Testing**

- Once fitted turn on water and check for leaks and correct operation.

**TROUBLESHOOTING**

PROBLEM	CAUSE	RECTIFICATION
Water is not flowing or inconsistent flow.	Blocked flow regulator/ dirt in the cartridge / water supply not on.	Remove flow regulator from inlet and remove debris. Install an inline strainer to stop further blockages. Ensure water supply is turned on.
Continous flow of water.	Top assembly cartridge loose or internally obstructed or damaged.	Remove cartridge, clean with water and re-grease spindle if required.
Rate of flow inadequate.	The flow restrictor may not be satisfactory due to inadequate supply pressure.	Remove flow restrictor and replace with a flow restrictor of different capacity to suit (available from Galvin Specialised).
Button hard to activate.	Mains pressure may be too high.  Spindle sticking	Reduce mains pressure to below 500kPa. Remove cartridge, clean with water and re-grease spindle if required.
Water shuts off upon release the button (if not time).	Small spring at the bottom of the cartridge piston dislodged.	Relocate spring, regrease spindle if required.

## WARRANTY

The warranty set forth herein is given expressly and is the only warranty given by the Galvin Engineering Pty Ltd. With respect to the product, Galvin Engineering Pty Ltd makes no other warranties, express or implied. Galvin Engineering Pty. Ltd. hereby specifically disclaims all other warranties, express or implied, including but not limited to the implied warranties of merchantability and fitness for a particular purpose.

Galvin Engineering Pty Ltd products are covered under our manufacturer's warranty available for download from [www.galvinengineering.com.au](http://www.galvinengineering.com.au) Galvin Engineering Pty Ltd expressly warrants that the product is free from operational defects in workmanship and materials for the warranty period as shown on the schedule in the manufacturer's warranty. During the warranty period, Galvin Engineering will replace or repair any defective products manufactured by Galvin Engineering without charge, so long as the terms of the Manufacturer's warranty are complied with.

The remedy described in the first paragraph of this warranty shall constitute the sole and exclusive remedy for breach of warranty, and Galvin Engineering Pty Ltd shall not be responsible for any incidental, special or consequential damages, including without limitation, lost profits or the cost of repairing or replacing other property which is damaged if this product does not work properly, other costs resulting from labour charges, delays, vandalism, negligence, fouling caused by foreign material, damage from adverse water conditions, chemical, electrical or any other circumstances over which Galvin Engineering has no control. This warranty shall be invalidated by any abuse, misuse, misapplication, improper installation or improper maintenance or alteration of the product.

Within Australia: 1300 514 074 Outside Australia: P: +61 (0)8 9338 2344

F: +61 (0)8 9338 2340

[sales@galvinengineering.com.au](mailto:sales@galvinengineering.com.au)

[www.galvinengineering.com.au](http://www.galvinengineering.com.au)

ABN: 78 008 719 382

PERTH | SYDNEY | MELBOURNE | BRISBANE | ADELAIDE

